



高精度SR253中文操作流程图

页1

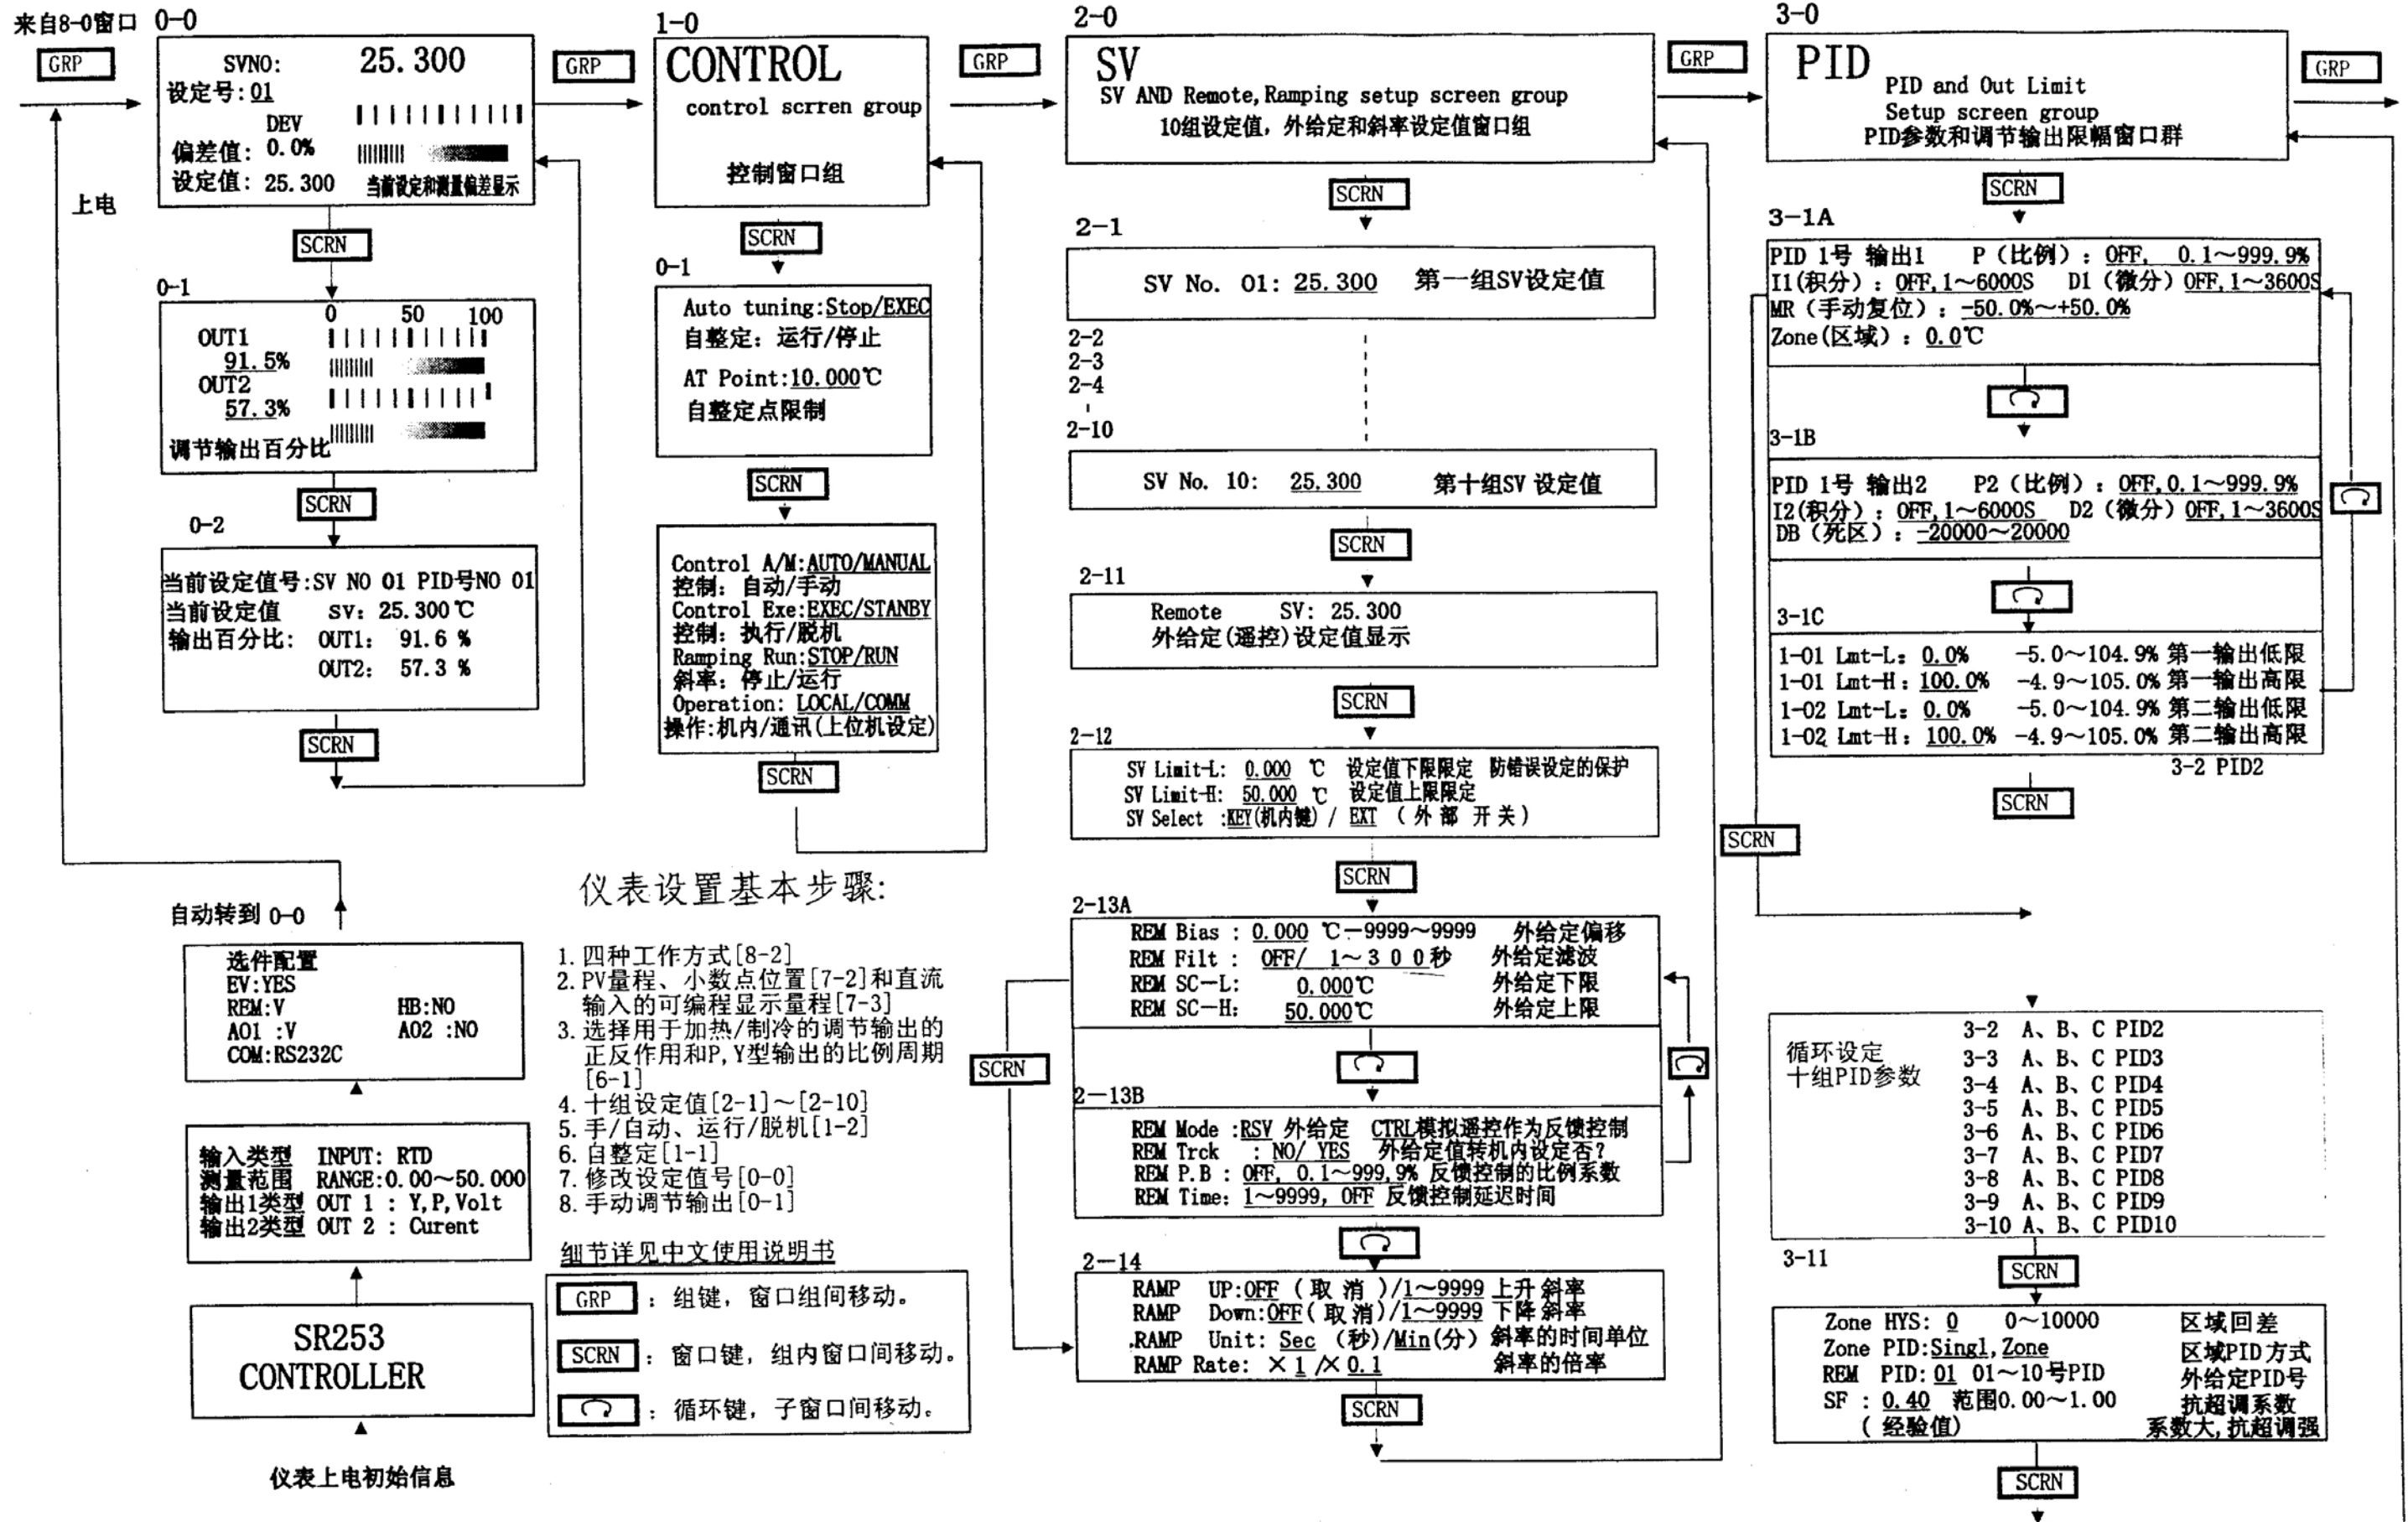

高精度SR253中文操作流程图

页2

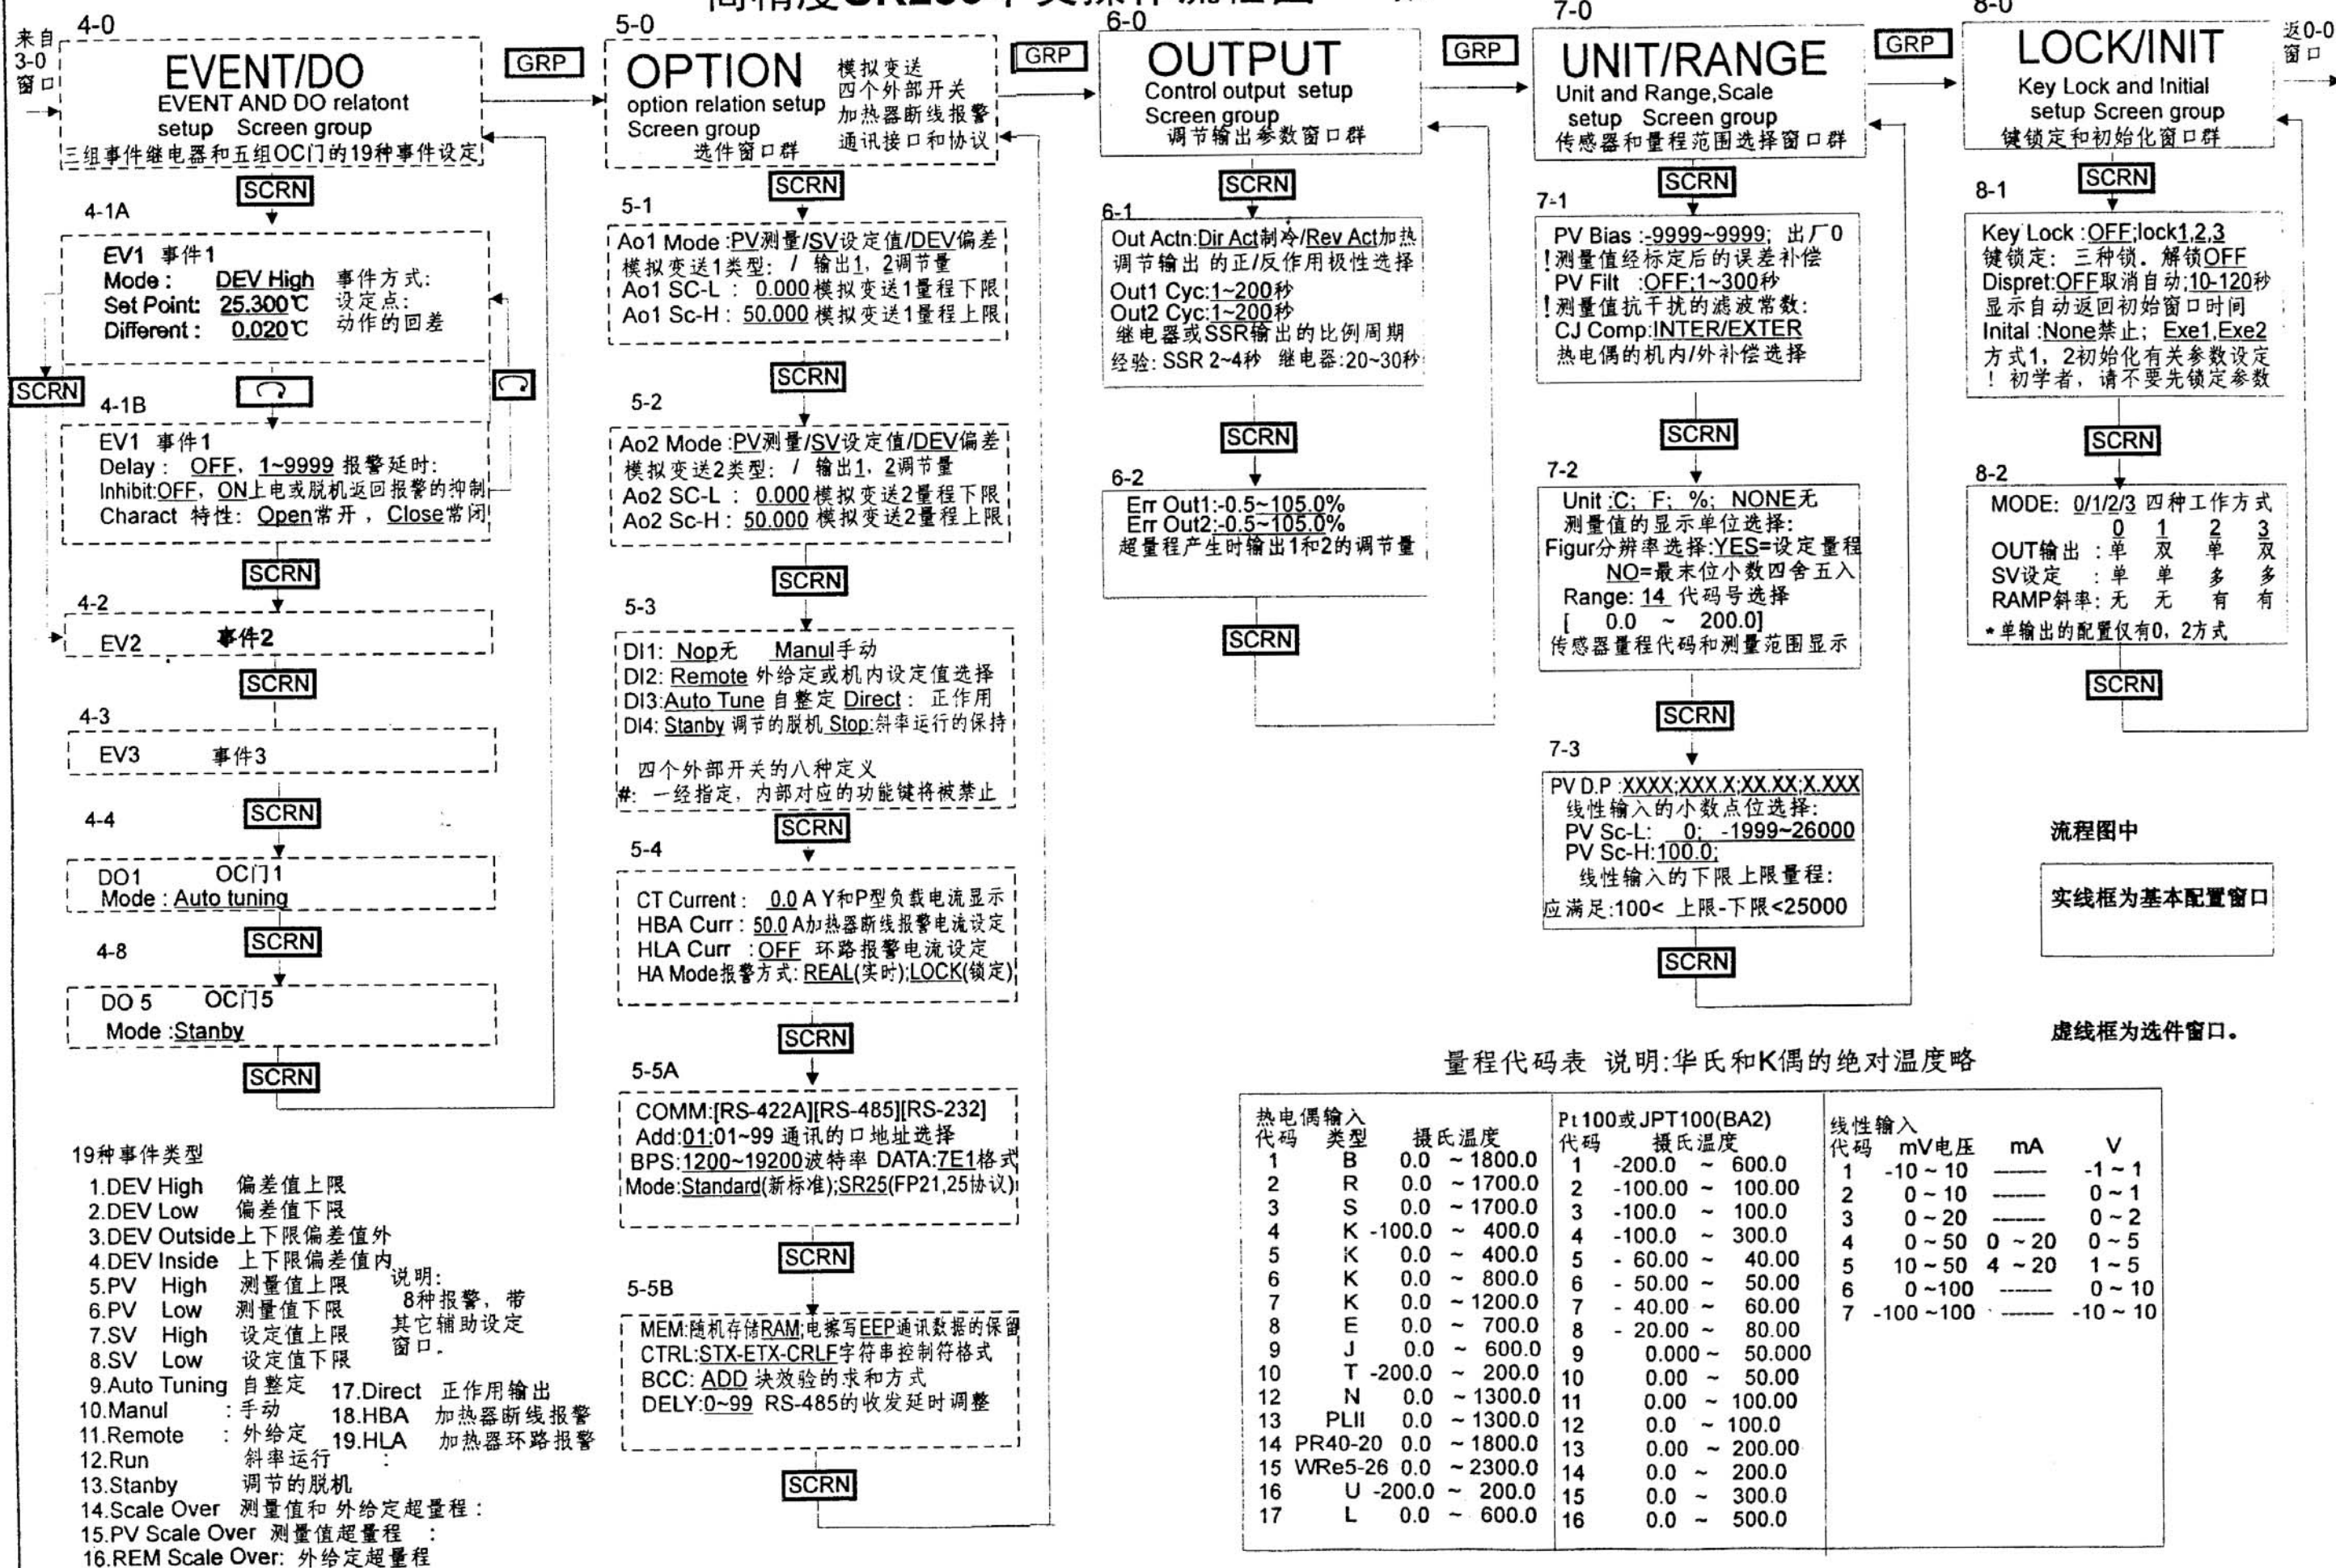

量程代码表 说明: 华氏和K偶的绝对温度略

热电偶输入 代码	类型	摄氏温度	Pt100或JPT100(BA2) 代码	摄氏温度	线性输入 代码	mV电压	mA	V
1	B	0.0 ~ 1800.0	1	-200.0 ~ 600.0	1	-10 ~ 10	—	-1 ~ 1
2	R	0.0 ~ 1700.0	2	-100.00 ~ 100.00	2	0 ~ 10	—	0 ~ 1
3	S	0.0 ~ 1700.0	3	-100.0 ~ 100.0	3	0 ~ 20	—	0 ~ 2
4	K	-100.0 ~ 400.0	4	-100.0 ~ 300.0	4	0 ~ 50	0 ~ 20	0 ~ 5
5	K	0.0 ~ 400.0	5	-60.00 ~ 40.00	5	10 ~ 50	4 ~ 20	1 ~ 5
6	K	0.0 ~ 800.0	6	-50.00 ~ 50.00	6	0 ~ 100	—	0 ~ 10
7	K	0.0 ~ 1200.0	7	-40.00 ~ 60.00	7	-100 ~ 100	—	-10 ~ 10
8	E	0.0 ~ 700.0	8	-20.00 ~ 80.00				
9	J	0.0 ~ 600.0	9	0.000 ~ 50.000				
10	T	-200.0 ~ 200.0	10	0.00 ~ 50.00				
12	N	0.0 ~ 1300.0	11	0.00 ~ 100.00				
13	PLII	0.0 ~ 1300.0	12	0.0 ~ 100.0				
14	PR40-20	0.0 ~ 1800.0	13	0.00 ~ 200.00				
15	WRe5-26	0.0 ~ 2300.0	14	0.0 ~ 200.0				
16	U	-200.0 ~ 200.0	15	0.0 ~ 300.0				
17	L	0.0 ~ 600.0	16	0.0 ~ 500.0				